

Fast Trak Display 4' and 6'

Product Parts

- 1 - Display
- 2 - Header
- 3 - Header Connector




Display Set-Up

Step 1

Remove all parts from the carry case and place on a clean, flat surface along with your graphic panels.

Step 2

Unfold the panels of the Display (1) until the unit lays flat on your surface. Place each graphic panel, with Hook side down, to connect to the panel's loop surface.

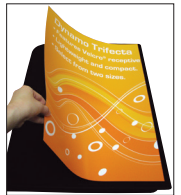

Repeat for the Header (2).


Step 3

Stand the unit upright on a table and move side panels to approximately 30 degree angles.



Step 4

Attach the Header Connector (3) to the bottom of the Header (2)

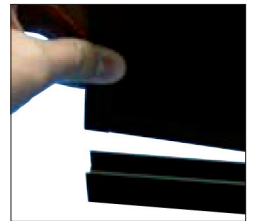


Step 5

Push the Header Connector (3) down to attach the Header (2) to the center panel on the Display (1).



Storage

Place all product parts into Carry Case and store in a cool, dry location.

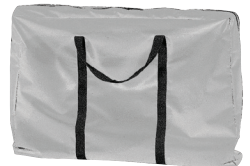

Care

Spot clean with a damp cloth.